



TECHNICAL SERVICE BULLETIN

NUMBER	16TSB-109			TYPE	APPLICATION ALERT				
ROUTING	INSTALL	X	SERVICE	X	SALES		PURCH		
TITLE	16071010 HEADLIGHT ADAPTER MISWIRED GM 2019-2022 1500/2020-2023 2500/3500								
REV	-			ISSUED	9/23/2024		REVISED		
AFFECTS	16071010 HEADLIGHT ADAPTER - USED ON GM 2019-2022 1500/2020-2023 2500/3500								

16071010 adaptor harnesses shipped between 07/26/2024 and 09/20/2024 may be miswired causing the truck lights to not function with out without the plow installed. All dealers affected have already been notified - this is a targeted TSB.

If this harness is used - the truck lights will not power on at all.

The faulty harnesses have pin 1 (corner) of the socket connector connected to pin 6 of the pin connector as shown in the pictures. On correct harnesses pin 1 goes back to the relay connector. There are two black wires - so trace the connection to pin 1 carefully.

The faulty harnesses may also have a green dot on the HARNESS LABEL, and a build date of 7/26/2024 or later on the BAG LABEL.

INFORMATION



INSTRUCTIONS

1. Inspect the harnesses to see if they are correct.
2. The 16071010 adapters may be reworked by swapping pins 1 and 6 on the socket side (with red locking tab) OR They may be returned for replacement by contacting your distributor.

Do NOT install adapters until wiring has been verified.
Corrected stock should be available by Friday 9/27.